




TYPICAL BRIDGE MOUNTED SIGN STRUCTURE

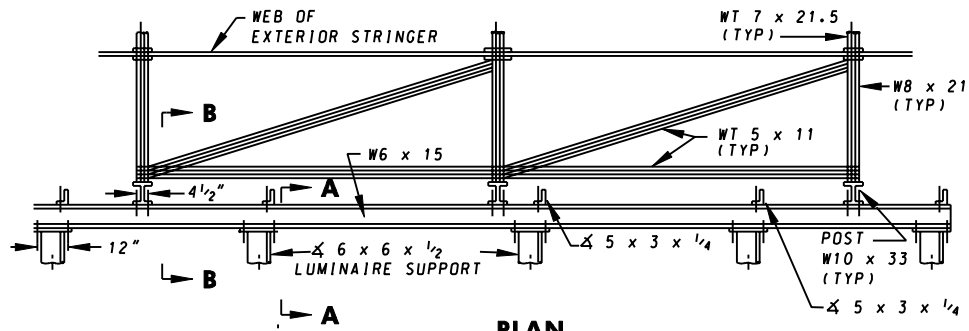

PLAN

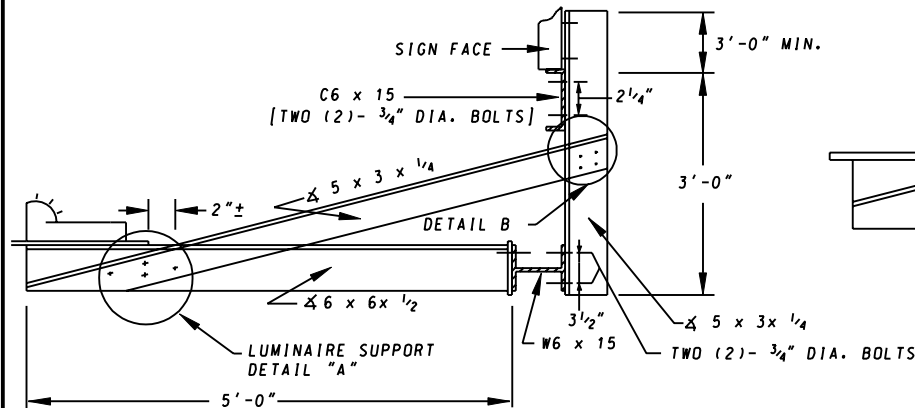


SECTION A-A

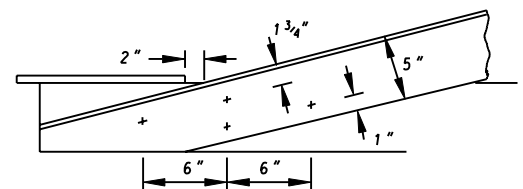


DETAIL 'A'

NOTES:

1. AFFECTED AREAS BY DRILLING HOLES IN THE FIELD SHALL BE CLEANED AND REPAIRED TO CONFORM TO A 780.
2. ALL CONNECTION BOLTS SHALL CONFORM TO A 325 WITH WASHERS & NUTS.

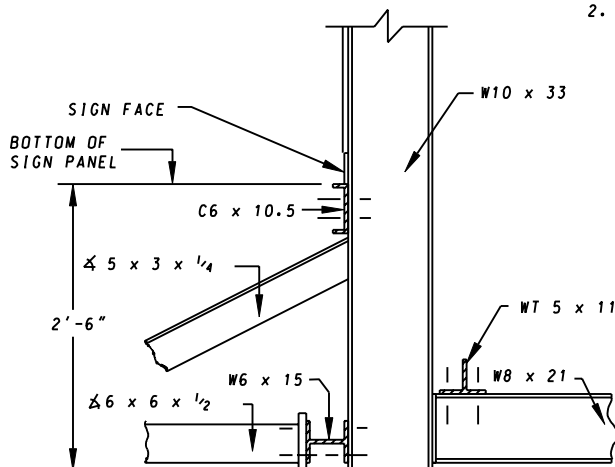

SECTION B-B

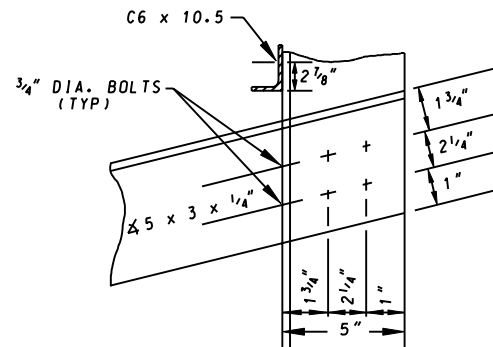

DETAIL 'B'

SPECIFICATION
402

CATEGORY CODE ITEMS

APPROVED

DIRECTOR - OFFICE OF TRAFFIC AND SAFETY



APPROVAL • SHA REVISIONS	APPROVAL • FEDERAL HIGHWAY ADMINISTRATION
APPROVAL 2-21-95	APPROVAL 2-21-95
REVISED 10-1-01	REVISED 2-1-01
REVISED	REVISED
REVISED	REVISED

Maryland Department of Transportation STATE HIGHWAY ADMINISTRATION

STANDARDS FOR HIGHWAYS AND INCIDENTAL STRUCTURES

SIGN / LUMINAIRE SUPPORTS MOUNTING FOR BRIDGE STRUCTURES

STANDARD NO.

MD 803.03